

Section Pictures - 16/05/2024 - 849005

Town or suburb Oranga	Location ORANGA TOC54	Date of inspection 16/05/2024	Asset ID 849005	Section No. 9
---------------------------------	---------------------------------	---	---------------------------	-------------------------



1, 00:00:00, 0.00m (21.00m)
Inspection start, node reference: 517286



2, 00:00:00, 0.00m (21.00m)
Inspection start, node reference: 517286



3, 00:00:36, 0.40m (20.60m)
Debris greasy, small, clear diameter is reduced by less than 10% from 4 o'clock to 8 o'clock, start / Pipe walls



4, 00:01:06, 2.73m (18.27m)
The sealing of the joint is faulty, large, clearly through the pipe wall from 8 o'clock to 4 o'clock / RIFM

Section Pictures - 16/05/2024 - 849005

Town or suburb	Location	Date of inspection	Asset ID	Section No.
Oranga	ORANGA TOC54	16/05/2024	849005	9



5, 00:01:06, 2.73m (18.27m)
Fine roots, restrict flow by 10% to 25% of full flow from 8 o'clock to 4 o'clock



6, 00:01:11, 3.22m (17.78m)
Fine roots, restrict flow by 10% to 25% of full flow from 8 o'clock to 4 o'clock




7, 00:01:28, 6.23m (14.77m)
Debris silt, small, clear diameter reduced by less than 10%, start / Gravel mud



8, 00:02:49, 20.94m (0.06m)
Debris silt, small, clear diameter reduced by less than 10%, end / Gravel mud

Section Pictures - 16/05/2024 - 849005

Town or suburb Oranga	Location ORANGA TOC54	Date of inspection 16/05/2024	Asset ID 849005	Section No. 9
---------------------------------	---------------------------------	---	---------------------------	-------------------------

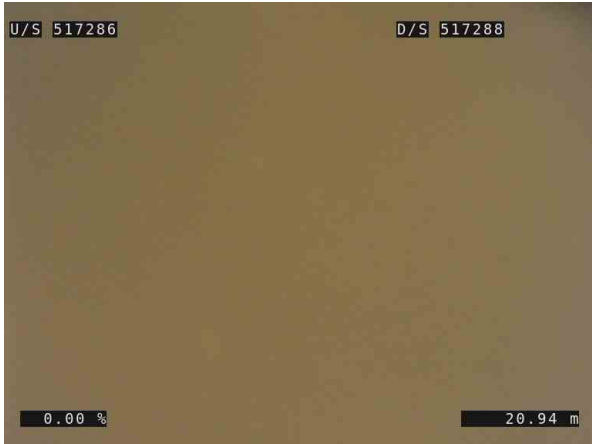

9, 00:02:49, 20.94m (0.06m)
Debris greasy, small, clear diameter is reduced by less than 10% from 4 o'clock to 8 o'clock, end / Pipe walls



10, 00:02:52, 21.00m (0.00m)
Inspection abandoned / have past boundary